



A. Vehicles with left hand drive up to approx. 08/85

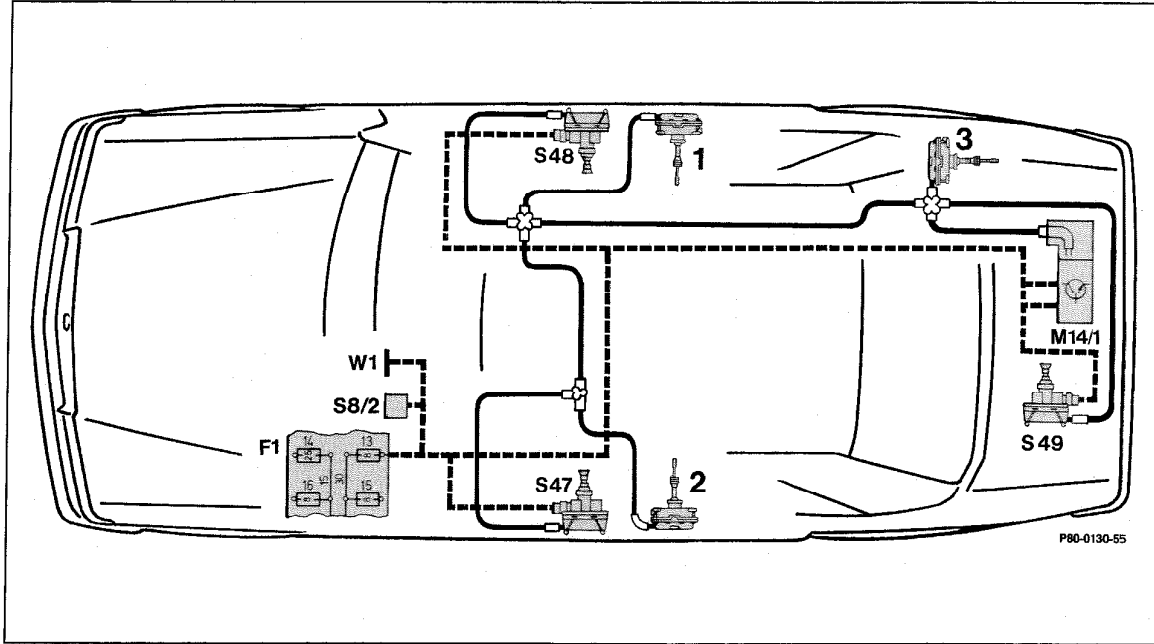

P80-0130-55

- | | | | |
|-------|--|---------|---|
| 1 | Element, rear door right (sedan only) | S47 | Left front door actuator |
| 2 | Element, rear door left (sedan only) | S48 | Right front door actuator |
| 3 | Element, tank flap | S49 | Trunk lid lock actuator |
| F1 | Fuse and relay box | W1 | Main ground (behind instrument cluster) |
| M14/1 | Supply pump (CL) | - - - - | Electrical cable |
| S8/2 | Warning buzzer contact (exterior lamps/CL) | — | Pneumatic pipe |

B. Vehicles with left hand drive as of approx. 09/85

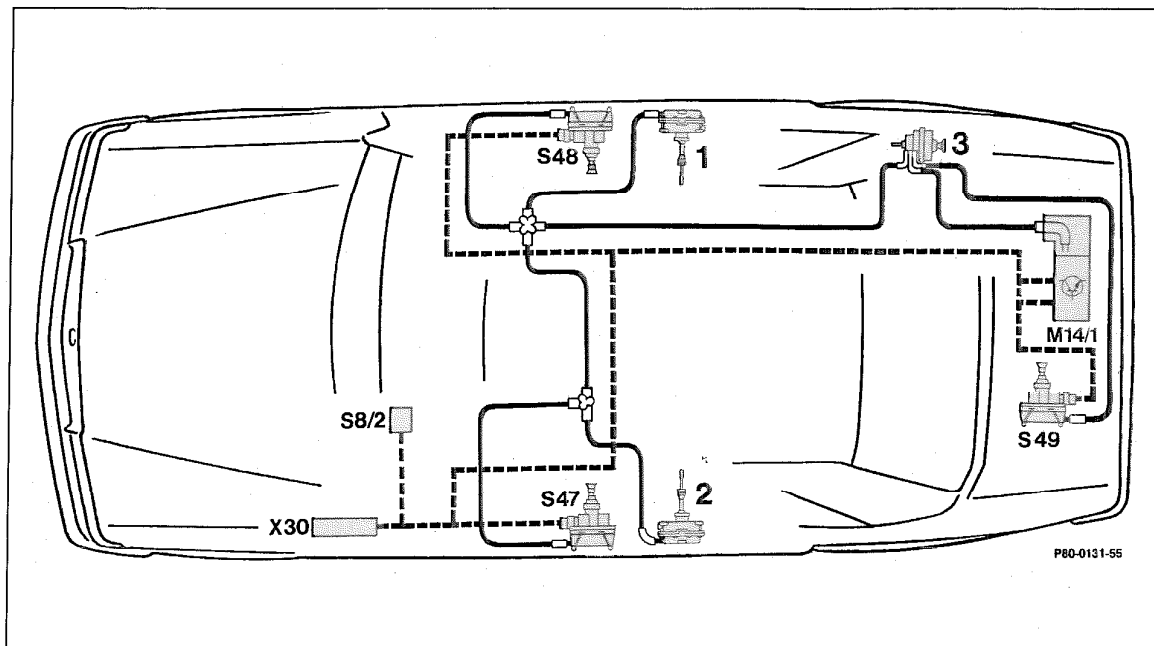

P80-0131-55

- | | | | |
|-------|--|------|-------------------------------------|
| 1 | Element, rear door right (sedan only) | S47 | Left front door actuator |
| 2 | Element, rear door left (sedan only) | S48 | Right front door actuator |
| 3 | Element, tank flap | S49 | Trunk lid lock actuator |
| M14/1 | Supply pump (CL) | X30 | Accessory equipment connector block |
| S8/2 | Warning buzzer contact (exterior lamps/CL) | ---- | Electrical cable |
| | | — | Pneumatic pipe |